

Report is: Final

330, 4311–12 Street N.E. Calgary, AB T2E 4P9 Bus: (403) 216-3485 Fax: (403) 216-3486 solutions@skystone.ca


Client:	ARC Resources Ltd.		LSD: 10	00/16-24	-023-13W4N	M PRN:	2551443		
Unit:	Compressor Station	Equ	ipment: De	ehy Tower		Asset Tag #:	A2551443		
Inspec	tor: Red Flame	SEI Proc:	P0061.FS	Date:	2010.06.04	Owner ID:	A2551443		
The following is a summary of the inspection performed. Additional information, where appropriate, is provided as attachments to this summary.									
	EXTERNAL								
	continued service, ext ms of major concern o						pection carried		
			INTERN	IAI					
Racad	on the UT thickness re	eadings obtained			aamad fit for	continued sw	eet service as		
	vessel, 5 year interval		THE VESSEL III	as been u	eemed nt for	continued sw	eet service as		
Top half of vessel not inspected as a man-lift is required to reach that height.									
			PSV						
	rified In Compliance:								
PSV Se	er# 88C3151 is set at 9	9929 kPa which is	at vessel M	AWP, serv	riced 04/2009	9.			
Summary									
Based on a thorough review of information supplied this vessel has been deemed fit for continued service, thorough inspection interval set to 5 yrs as per AB-506 Gr 2 Vessel.									
Post R	epair Inspection Requi	red:				Next Inter	vals:		
Next Inspection Type: UT/NDE					Internal:				
Final Disposition: Fit For Service – As Is						Evtornal:	60.0 mth		
rillai L	isposition: Fit For Se	ervice – As Is				External: UT/NDE:	60.0 mth 60.0 mth		

Generated On: Sep 05, 2010

Inspection Details							




Overview 1

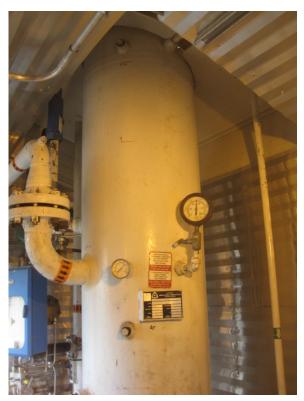

Overview 2



Overview 3

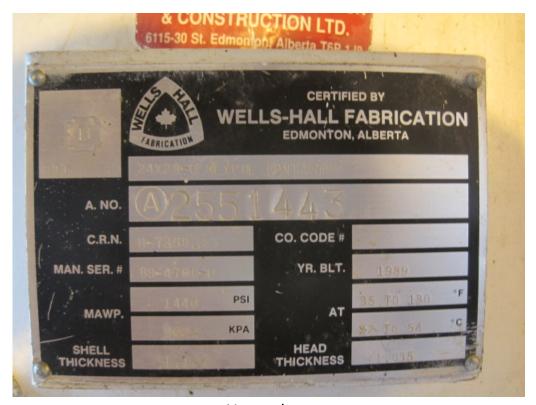


Nameplate




**PSV** Overview



PSV Nameplate 1

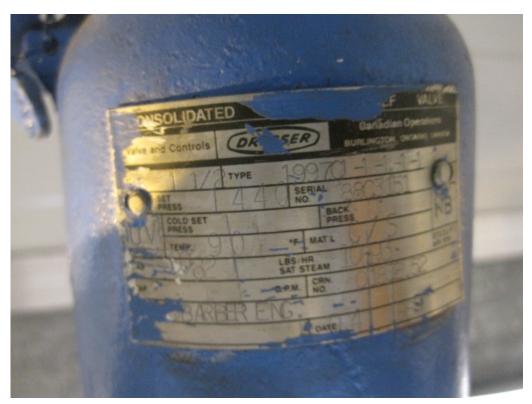

PSV Nameplate 2

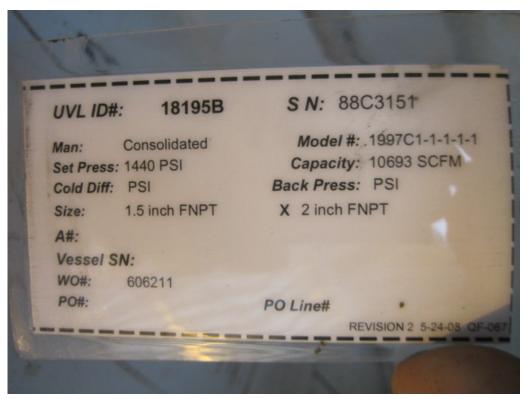

**PSV Service Tag**