

Mountain West Services Ltd.

#3, 14 Thevenaz Industrial Trail, Sylvan Lake, AB T4S 2J5

Field Inspection Report - CNRL 420758_2/22/2012_VT_External

Vessel Number	420758	Vessel Name	LINE HEATER	Province	Alberta
District	WEST COUNTY	LSD	04-26-074-11W6	Location	VALHALLA
Method	VT	Access	External	Cleaning	Good
Inspection Date	2/22/2012	Inspection Interval	36	Next Inspection	2/22/2015
CRN	N-0291.2	Skid Number	SKID0241	Service	
Manway	NO	Coating	False	Status	In Service
MAWP (PSI)	3130.11	MAWP (Kpa)	21581		
MAWT (F)	93.33	MAWT (C)	200	Outstanding NCRS	0

General

Safety Valves

PSV MWS64174 Coil2 side. Set pressure 1480.1332 PSI / 8279 KPa. Capacity: 8279 SCFM / 234.44 m3/min.

PSV MWS64174 Coil1 side. Set pressure 3130.10824 PSI / 8279 KPa. Capacity: 8279 SCFM / 234.44 m3/min.

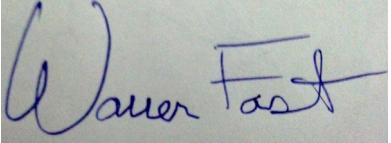
PSV NON-CODE Shell side. Set pressure 10 PSI / 0 KPa. Capacity: 0 SCFM / 0 m3/min.

External

All visible shell surfaces and nozzles appear in good condition. Name plate is intact and legible. Vessel supports, foundation, electrical bonding and external coating appear good. Associated piping, supports and components appear in good condition and alignment with no signs of leaks or defects present at the time of inspection. PSV is set at the correct PSI and has been serviced.

Recommendations

INSPECTOR : I have witnessed/done the above inspections and certify that they have been done in accordance with our approved manual and that the information is accurate. I certify that the status of the Pressure equipment detailed here is:

Suitable to be returned to Service	Yes	Repairs complete (AB-40 attached)	N/A
Repairs are still required	No	Suggested Inspection interval	36
Warren Fast Inspector			2/27/2012 Date

